



MOTOR PROTECTION RELAY, NON PHASE FAILURE / NON SINGLE PHASE SENSITIVE. THREE POLE (THREE PHASE), MANUAL OR AUTOMATIC RESETTING. DIRECT MOUNTING ON BF09 - BF38 CONTACTORS, 9...14A



Product designation			RFN38 Motor protection
Product type designation			relay
General characteristics			
Number of poles		nr.	3
Overvoltage category			Ш
Pollution degree			3
Frontal IP degree			IP20
Type of release			Thermal
Protection fuse			
	gG (IEC)	Α	32
	aM (IEC)	Α	16
	RK5 (UL)	Α	50
Phase failure detection			No
Reset mode			Manual or
Reset mode			automatic
Power circuit characteristics			
Rated insulation voltage Ui IEC/EN		V	690
Rated impulse withstand voltage Uimp		kV	6
Rated operational voltage		V	690
Operational frequency			
	min	Hz	0
	max	Hz	400
Operational current le			
'	Operational current min	Α	9.00
	Operational current max	Α	14
Tripping class			10A
Test Button			Yes
Trip indicator			Yes
Terminals			
			Screw and
	type		washer
	screw		M4
	width	mm	12.6
	tool		Phillips 2
Tightening torque for terminals			· ······po =
	min	Nm	2
	max	Nm	2.5
	min	lbin	1.5
	max	Ibin	1.8
Conductor section	IIIdA	10111	1.0
Outdoold Scotlott	AWG/kcmil max		8
Auxiliary circuit characteristics	AVVG/RCITIII ITIAX		O
•			
Auxiliary contacts	NO	nr.	1






MOTOR PROTECTION RELAY, NON PHASE FAILURE / NON SINGLE PHASE SENSITIVE. THREE POLE (THREE PHASE), MANUAL OR AUTOMATIC RESETTING. DIRECT MOUNTING ON BF09 - BF38 CONTACTORS, 9...14A

	NC	nr.	1
Auxiliary Rated insulation voltage Ui IEC/EN		V	690
Auxiliary Rated impulse withstand voltage Uimp		kV	6
Auxiliary Rated operational voltage		V	690
Operating current AC15			
	24V	Α	3
	120V	Α	3
	240V	Α	1.5
	380V	Α	0.95
	480V	Α	0.75
	500V	Α	0.72
	600V	Α	0.6
Operating current DC13			
	125V	Α	0.11
	600V	Α	0.22
EC Conventional free air thermal current Ith		Α	10
Terminals			
	Auxiliary circuit type		Screw and
	•		washer
	Auxiliary circuit screw		M3,5
	Auxiliary circuit width	mm	8
	Auxiliary circuit tool		Phillips 2
Conductor section			
	Auxiliary circuit Flexible w/o lug max	mm²	2.5
	Auxiliary circut Flexible c/w lug max	mm²	2.5
Fightening torque for terminals			
	Auxiliary circuit min	Nm	0.8
	Auxiliary circuit max	Nm	1
	Auxiliary circuit min	lbin	0.59
	Auxiliary circuit max	Ibin	0.74
JL/CSA and IEC/EN 60947-5-1 designation			B600-R300
Ambient conditions			
Operating temperature			
	min	°C	-25
	max	°C	60
Storage temperature			
	min	°C	-50
	max	°C	70
Compensation temperature			
	min	°C	-20
	max	°C	60
Max altitude		m	3000
Mechanical features			
Operating position			
	normal		Vertical plan
	allowable		±30°
Weight		g	160
JL technical data			
UL technical data			
UL technical data Full-load current (FLA) for three-phase AC motor	at 480V at 600V	A A	14 14


ENERGY AND AUTOMATION

MOTOR PROTECTION RELAY, NON PHASE FAILURE / NON SINGLE PHASE SENSITIVE. THREE POLE (THREE PHASE), MANUAL OR AUTOMATIC RESETTING. DIRECT MOUNTING ON BF09 - BF38 CONTACTORS, 9...14A


BF00 A... BF09 A... - BF12 A... - BF18 A... - BF25 A... three poles with RF...38 thermal overload relay

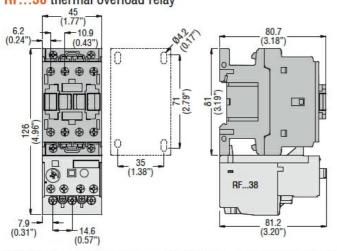

BF26 00A... - BF32 00A... - BF38 00A... three poles with RF...38 thermal overload relay

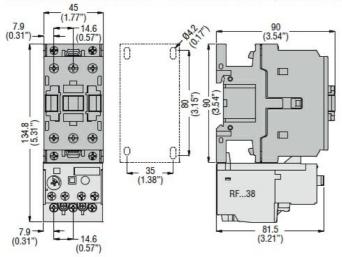

Wiring diagrams

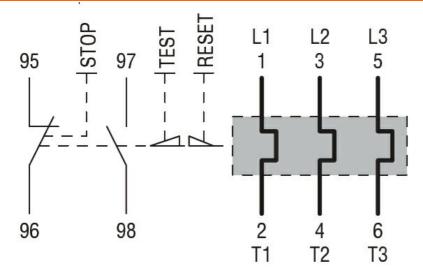

Certifications and compliance

Compliance

CSA C22.2 n° 14

IEC/EN 60947-1

IEC/EN 60947-4-1



ENERGY AND AUTOMATION

THREE POLE (THREE PHASE), MANUAL OR AUTOMATIC RESETTING. DIRECT MOUNTING ON BF09 - BF38 CONTACTORS, 9...14A

UL508
CCC
cULus
EAC

RFN381400